

Fiberoptic Sensor - *Reflectance Dependent**

Model D171

Fiberoptic Cable & Sensor Tip - Actual Size





For The Measurement of Distance, Displacement and Vibration

Features

- Largest Range and Operating Gaps in the D Series
- \varnothing 4.34 mm Target Spot Size (0.171 inch)
- 50 mm Total Operating Range (2.0 inch)
- 200 mv/mm Far Side Sensitivity (8 mv/mil)
- 0.9 mv/ μ m Near Side Sensitivity (22mv/mil)

Tip & Cable Dimensions

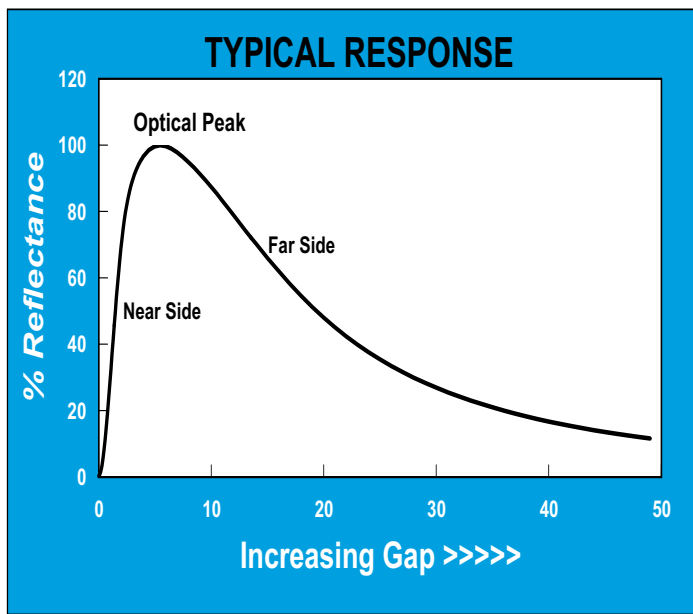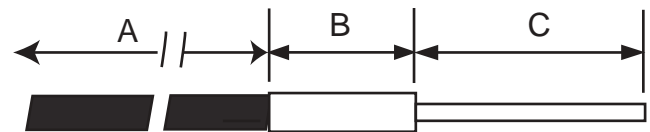

FEATURE	mm	inch
Tip Outer Diameter, \varnothing C	4.75	0.187
Fiberoptic Diameter	4.34	0.171
Tip Length, C	76.2	3
Collar Length, B	15.9	0.625
Collar Diameter, \varnothing B	7.92	0.312
Cable Length, A	914	36
Cable Diameter, \varnothing A	6.86	0.27
Cable Min. Bend Radius	25.4	1

*These are reflective type transducers based upon detecting the intensity of reflected light. With D Model sensors, the output signal is proportional to: a) the gap distance from the sensor tip-to-target; and, b) the reflectivity of the target surface. D models are commonly used in applications where the target has a reciprocating or vibratory motion parallel to the axis of the sensor.

PHILTEC

A-tech Instruments Ltd. Ph: (416) 754-7008 Fax: (416) 754-2351 Email: sales@a-tech.ca Web: www.a-tech.ca

Precision Dynamic Measurements



Two Instrument Packages To Choose From

This sensor can be provided as an analog or as a digital instrument.
For available options and how to order go to www.philtec.com




Analog sensors are fast responding units ideal for relative motion measurements in dynamic applications:

- DC-20 KHz is standard
- DC-200 KHz or higher is optional

Standard analog units include:

- Electronics with 0 to +5 VDC output
- 3 foot long fiberoptic cable

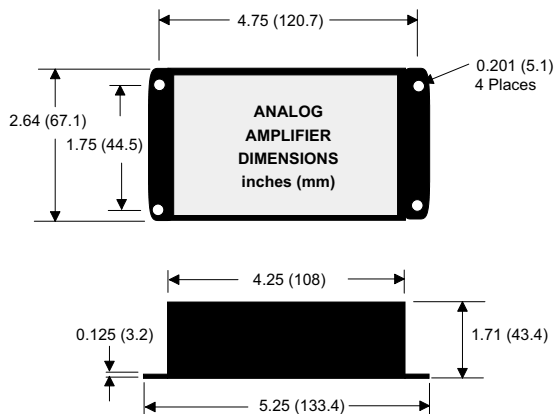

ANALOG OUTPUT

There are three ways to derive accurate distance measurements:


- within the bounds of the linear range, multiply sensitivity x the change in voltage output
- create a lookup table using the XY calibration data points
- use a polynomial curve fit to accurately map the sensor's output function

The effect of changing target reflectance is to shift the voltage output higher or lower. A gain control is provided for calibration of the sensor output to various target surfaces. In-situ calibration is performed simply, by adjusting the sensor's tip-to-target gap until the peak output is attained, and then by using the gain control to set the peak voltage reading to full scale. This allows the sensor to be used to perform precision linear motion measurements on most materials.

Displacement Measurement Systems (DMS) are the best choice for absolute distance measurements, multiplexing and process control applications, with data rates up to 5,000 readings/second.

Standard DMS units include:

- Electronics with RS-232 communication
- Keypad/LCD for local operation
- Temperature Stabilized Electronics

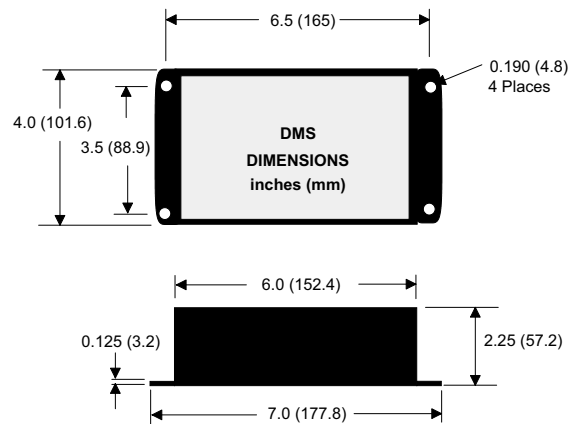

DMS dimensions shown are for single and for dual channel systems

DIGITAL OUTPUT

Accurate gap calibration data is stored on board the DMS. The D model DMS provides accurate distance measurements over the sensor's entire operating range, near side and far side, so long as the reflectivity of the target surface remains unchanged.

To make these distance measurements, two preliminary commands must be given:


- select near side or far side
- set the optical peak

The peak is set simply by adjusting the sensor's tip-to-target gap until the peak reflectance value is attained, and then by pressing SELECT OPTICAL PEAK.

30 additional slots are provided for storage of calibration data. Functions include tare, calibration scaling and pk-pk readings.

PHILTEC Model D171

Typical Response - Far Side

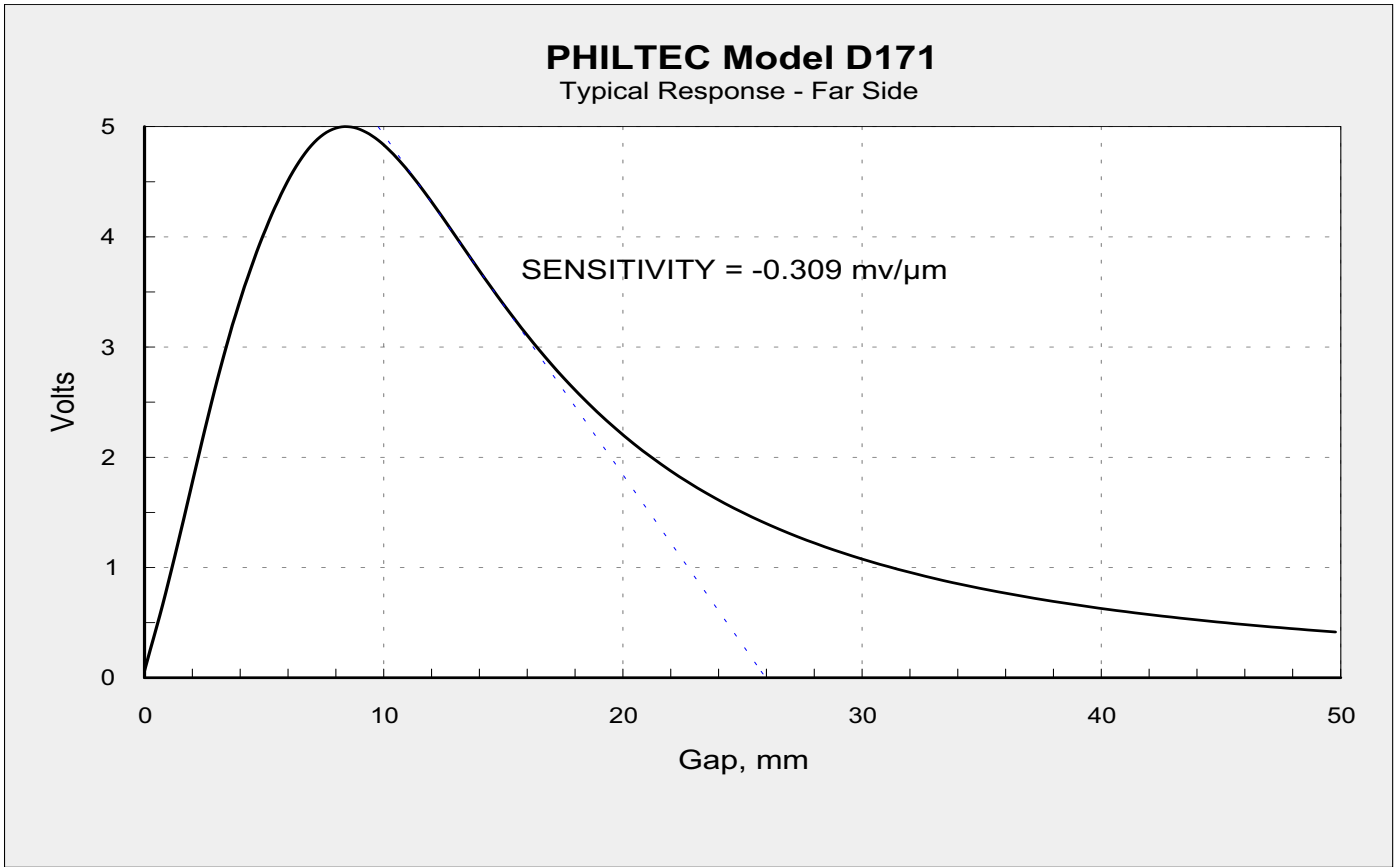

Conversions: 1 micron = 39.4 microinch 1 mm = 39.4 mils 1 mil = 0.001 inch = 25.4 microns = 0.0254 mm

Standard Specifications - D171 Far Side


Electronics		Fiberoptics		Outputs					
	Analog	DMS	Light Beam spread	25°	Analog Voltage			DMS RS232	
Light Source	LED, 850 nm		Cable Sheathing	PVC over Steel Monocoil	Total Range	2.0 in.	50 mm	Total Range	50 mm
Input Voltage	+12 to +24 VDC	+12 VDC	Tip Material	300 Series SS	Linear Range	0.25 in.	6.4 mm	Distance	16 bit resolution (31 μinch; 0.76 μm)
Input Current	125 ma max	500 ma max	Tip Epoxy Outgas	0.3% @ 200°C 2.4% @ 300°C	Nominal Standoff	0.55 in.	14 mm	Reflectance	8 bit resolution
Bandwidth	DC-20 KHz 3 db down	5 KHz max	Tip Operating Pressure	35 bar	Sensitivity	8 mv/mil	0.3 mv/μm	Amplifier Temperature	12 bit resolution
Iso-thermal Drift	0.5%	0.05%	Tip Operating Temperature	-55 to 175°C continuous; to 350°C intermittent 1-2 hours	Noise	DC - 200KHz DC - 20 KHz DC - 100 Hz	1500 μin 650 μin 65 μin	Noise Pk-Pk Units/Second at Mid Range using 50% Signal Power	ADC AVG = 1 pk-pk = 5 μm ADC AVG = 16 pk-pk = 2 μm ADC AVG = 256 pk-pk = .75 μm ADC AVG = 4096 pk-pk = 0.2 μm

Custom Hardware To Customer Specifications



PHILTEC Model D171

Typical Response - Near Side

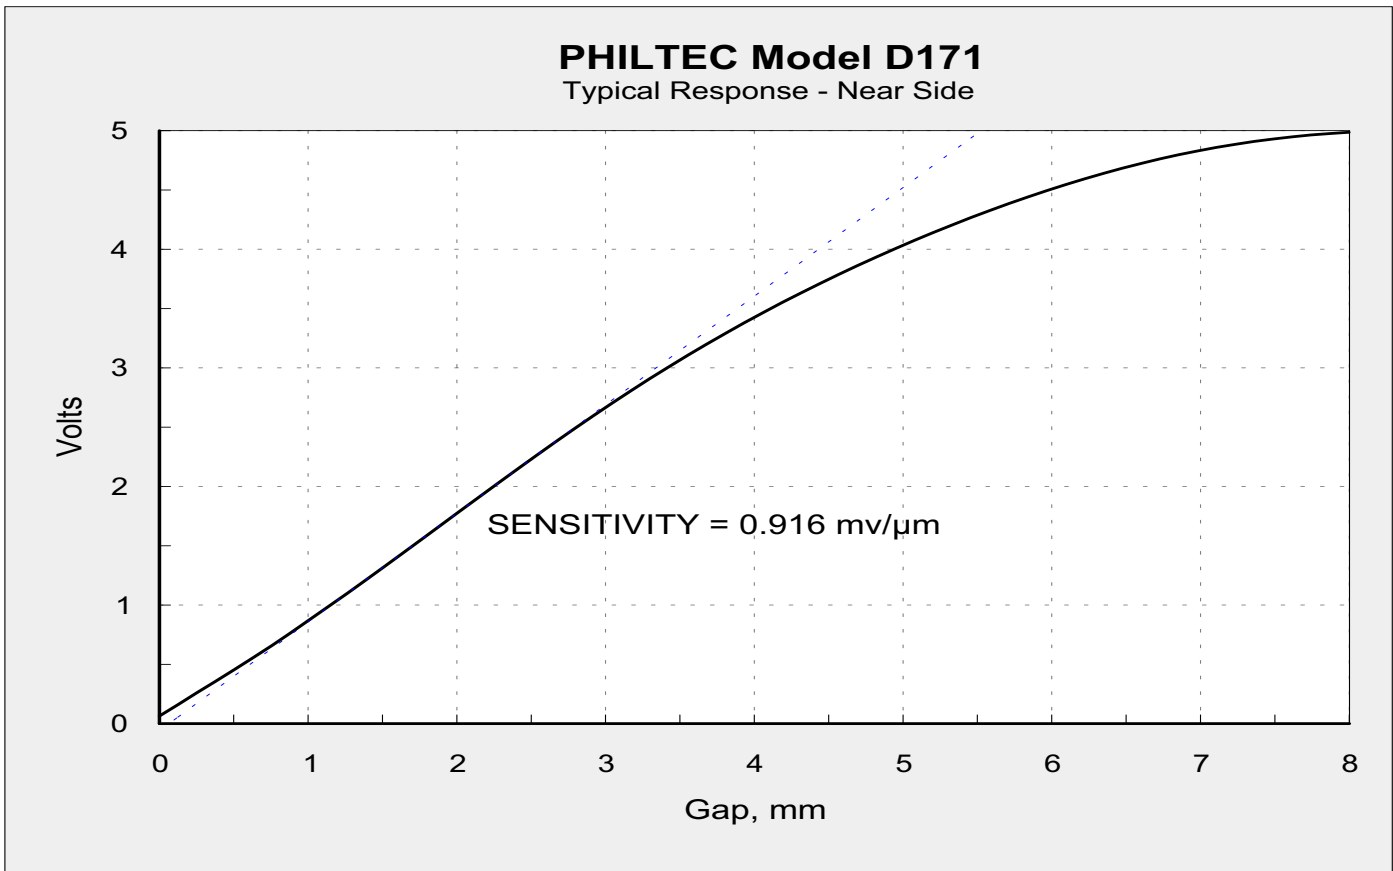

Conversions: 1 micron = 39.4 microinch 1 mm = 39.4 mils 1 mil = 0.001 inch = 25.4 microns = 0.0254 mm

Standard Specifications - D171 Near Side

Electronics		Fiberoptics		Outputs					
	Analog	DMS	Light Beam spread	25°	Analog Voltage			DMS RS232	
Light Source	LED, 850 nm		Cable Sheathing	PVC over Steel Monocoil	Total Range	0.35 in.	8.9 mm	Total Range	8.9 mm
Input Voltage	+12 to +24 VDC	+12 VDC	Tip Material	300 Series SS	Linear Range	0.1 in.	25 mm	Distance	16 bit resolution (5.3 μinch; 0.13 μm)
Input Current	125 ma max	500 ma max	Tip Epoxy Outgas	0.3% @ 200°C 2.4% @ 300°C	Nominal Standoff	0.125 in.	3.1 mm	Reflectance	8 bit resolution
Bandwidth	DC-20 KHz 3 db down	5 KHz max	Tip Operating Pressure	35 bar	Sensitivity	22 mv/mil	0.9 mv/μm	Amplifier Temperature	12 bit resolution
Iso-thermal Drift	0.5%	0.05%	Tip Operating Temperature	-55 to 175°C continuous; to 350°C intermittent 1-2 hours	Noise	DC - 200KHz DC - 20 KHz DC - 100 Hz	675 μin 135 μin 13 μin	Noise Pk-Pk Units/Second at Mid Range using 50% Signal Power	ADC AVG = 1 pk-pk = 2.5 μm ADC AVG = 16 pk-pk = 1.5 μm ADC AVG = 256 pk-pk = 300 nm ADC AVG = 4096 pk-pk = 100 nm

Many Options are Available Including Replaceable Tips, Vacuum Passtrus and Non-Metallic Tips

